

[REDACTED]

From:

Sent:

28 July 2026 12:28

To:

[REDACTED] Michael Miller; Sandy Rintoul; [REDACTED]

Cc:

Subject:

RE: E20955.00 - St Cuthbert's RC Primary School - Pre Construction Info Pack

Attachments:

E20955.00-WRD-ZZ-ZZ-DR-S-200003-TYPICAL STRUCTURAL DETAILS.pdf;

E20955.00 - WRD Structural Issue Sheet.pdf

[REDACTED]

Hi [REDACTED]

Please find attached updated detail sheet along with document register.

Best Regards



[REDACTED]
Project Engineer

for Will Rudd

MEng(Hons), CEng,

AIStructE

Please note my working

days are Monday to

Thursday

Will Rudd Davidson (Edinburgh) Ltd | 43 York Place | Edinburgh | EH1 3HP

To view our e-mail disclaimer, please click [here](#).

From: [REDACTED]

Sent: 27 July 2026 17:57

To: [REDACTED] Michael
Miller <michael.miller@edinburgh.gov.uk>; Sandy Rintoul <sandy.rintoul@edinburgh.gov.uk>; [REDACTED]

Subject: Re: E20955.00 - St Cuthbert's RC Primary School - Pre Construction Info Pack

[REDACTED]

Thanks [REDACTED]

We will get this shared with the supply chain first thing tomorrow.

If you can issue the follow up details that would be ideal.

Regards

[REDACTED]
Fabric Facilities Manager

Skanska UK

Building Services

Suite 3B, Avondale House, Phoenix Crescent,
Strathclyde Business Park, Bellshill, ML4 3NJ

skanska.co.uk

Follow Skanska on

[Twitter](#) [Facebook](#) [LinkedIn](#) [YouTube](#)

More than 135 years in the making, Skanska Group is one of the largest construction and development companies in the world.

Privileged or confidential information may be contained in this message. If you are not the addressee indicated in this message (or responsible for delivery of the message to such person), you may not copy or deliver this message to anyone. In such case, you should notify us immediately, and destroy this message. Skanska UK Plc is registered in England. Registration Number: 784752. Registered address: 1 Hercules Way, Leavesden, Watford WD25 7GS.

From: [REDACTED]

Sent: Monday, July 27, 2026 17:17

To: [REDACTED] Michael
Miller <michael.miller@edinburgh.gov.uk>; Sandy Rintoul <sandy.rintoul@edinburgh.gov.uk>; [REDACTED]

Subject: RE: E20955.00 - St Cuthbert's RC Primary School - Pre Construction Info Pack

Hi [REDACTED]

Please find attached updated drawings as we discussed. We will follow up with a small update to the detail sheet to reflect the bearing between the classrooms not being staggered. Let me know if you require anything further.

Best Regards



Project Engineer

for Will Rudd

MEng(Hons), CEng,
A1StructE

*Please note my working
days are Monday to
Thursday*

Will Rudd Davidson (Edinburgh) Ltd | 43 York Place | Edinburgh | EH1 3HP

To view our e-mail disclaimer, please click [here](#).

From: [REDACTED]
Sent: 27 July 2026 10:30
To: [REDACTED]; Michael Miller <michael.miller@edinburgh.gov.uk>; Sandy Rintoul <sandy.rintoul@edinburgh.gov.uk>; [REDACTED]
[REDACTED]
Subject: Re: E20955.00 - St Cuthbert's RC Primary School - Pre Construction Info Pack
Importance: High

[REDACTED]

Thank you for the PCI and construction drawing package issued.

We are currently reviewing this and will revert in due course.

In the meantime can you advise on drawing references:

E20955.00-WRD-ZZ-01-DR-S-200001 Rev C01 & E20955.00-WRD-ZZ-02-DR-S-200002 Rev C01

We were of the understanding the steelwork passing through the party wall on the ground floor and upper floor levels was not to be staggered which would reduce the opening to the party wall and a single 4.0Mtr steel would split the party wall.

Can you advise accordingly and amend.

The above was an agreed simplification discussed with [REDACTED] and Michael Miller following receipt of the design drawings being issued by the CoEC 2/06/26.

Please note the above has a significant impact on the steel order process and I have placed a call to your office this morn-ng to discuss directly.

Regards

[REDACTED]
Fabric Facilities Manager

[REDACTED]
[REDACTED]

Skanska UK
Building Services
Suite 3B, Avondale House, Phoenix Crescent,
Strathclyde Business Park, Bellshill, ML4 3NJ

skanska.co.uk

Follow Skanska on
[Twitter](#) [Facebook](#) [LinkedIn](#) [YouTube](#)

More than 135 years in the making, Skanska Group is one of the largest construction and development companies in the world.

Privileged or confidential information may be contained in this message. If you are not the addressee indicated in this message (or responsible for delivery of the message to such person), you may not copy or deliver this message to anyone. In such case, you should notify us immediately, and destroy this message. Skanska UK Plc is registered in England. Registration Number: 784752. Registered address: 1 Hercules Way, Leavesden, Watford WD25 7GS.

From: [REDACTED]
Sent: Friday, July 24, 2026 15:07
To: Michael Miller <michael.miller@edinburgh.gov.uk>; Sandy Rintoul <sandy.rintoul@edinburgh.gov.uk>;
[REDACTED]
[REDACTED]

Subject: E20955.00 - St Cuthbert's RC Primary School - Pre Construction Info Pack

[REDACTED]

Good afternoon all

As per recent discussions, please find attached our Pre Construction info pack for St. Cuthbert's along with responses to the latest RFIs.

We trust this provides the information required at this stage however please drop us a line or give us a call if you require anything further.

Thank you

Kind Regards




[REDACTED]
Senior Associate for
Will Rudd

*BSc(Hons),
CEng, MStructE*




Will Rudd Davidson (Edinburgh) Ltd | 43 York Place | Edinburgh | EH1 3HP
To view our e-mail disclaimer, please click [here](#).

NOTE:
NEW STEEL BEAMS TO BE INSTALLED TIGHT TO THE UNDERSIDE OF THE EXISTING CONCRETE FLOOR WHERE PRACTICABLE. DUE TO EXISTING FLOOR DEFLECTIONS, GAPS BETWEEN STEEL AND CONCRETE SOFFIT WILL OCCUR. NEW TIMBER JOISTS SHALL BE INSTALLED TIGHT TO THE UNDERSIDE OF THE EXISTING FLOOR, INCLUDING ABOVE THE LEVEL OF THE STEEL BEAMS WHERE NECESSARY, TO PROVIDE CONTINUOUS SUPPORT. ALL GAPS TO BE PACKED WITH APPROVED NON-COMPRESSIBLE MATERIALS TO ENSURE EFFECTIVE LOAD TRANSFER.

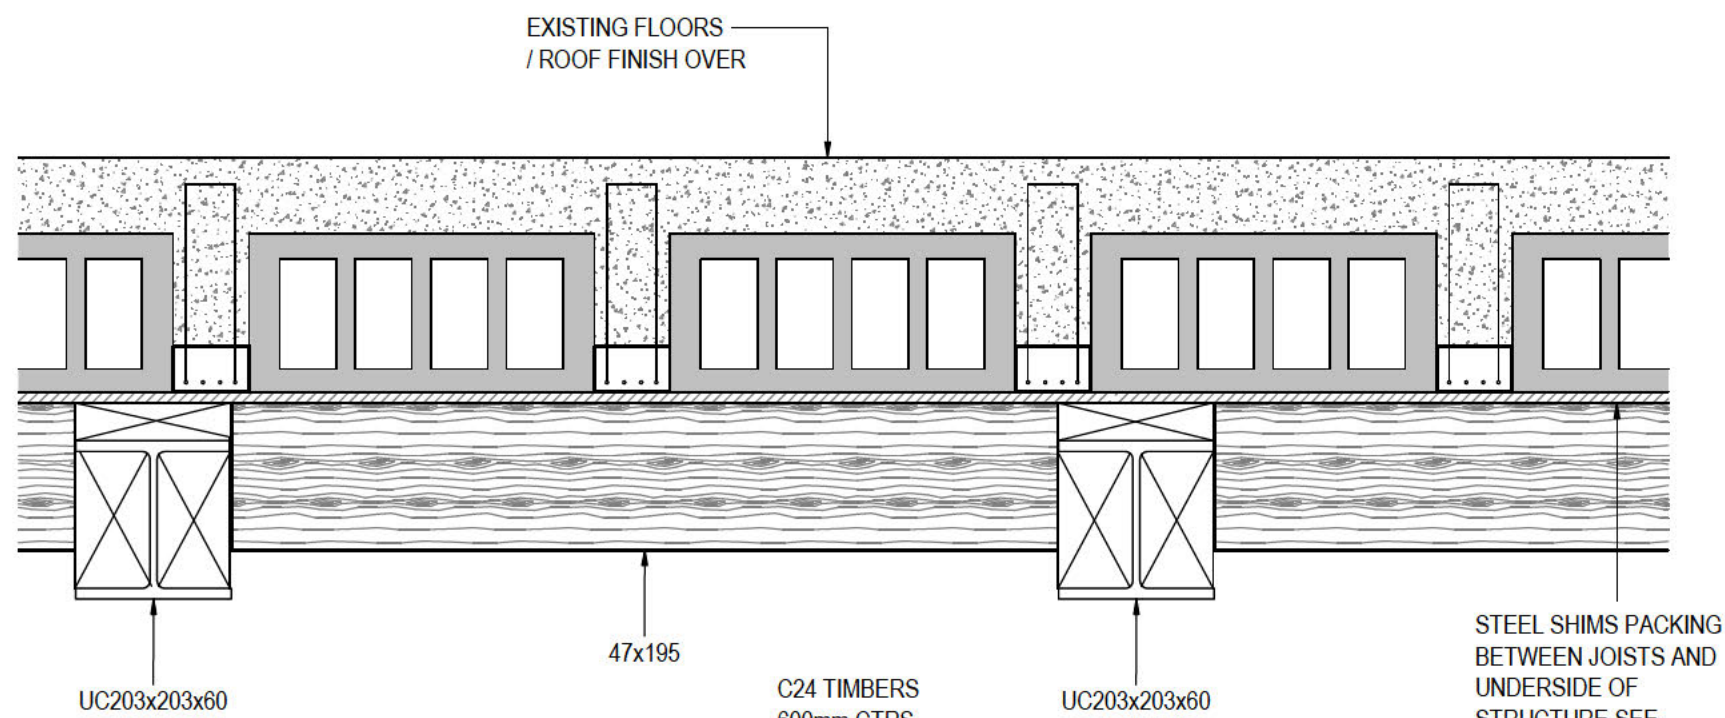

1 SECTION
Section 1
SCALE 1:10

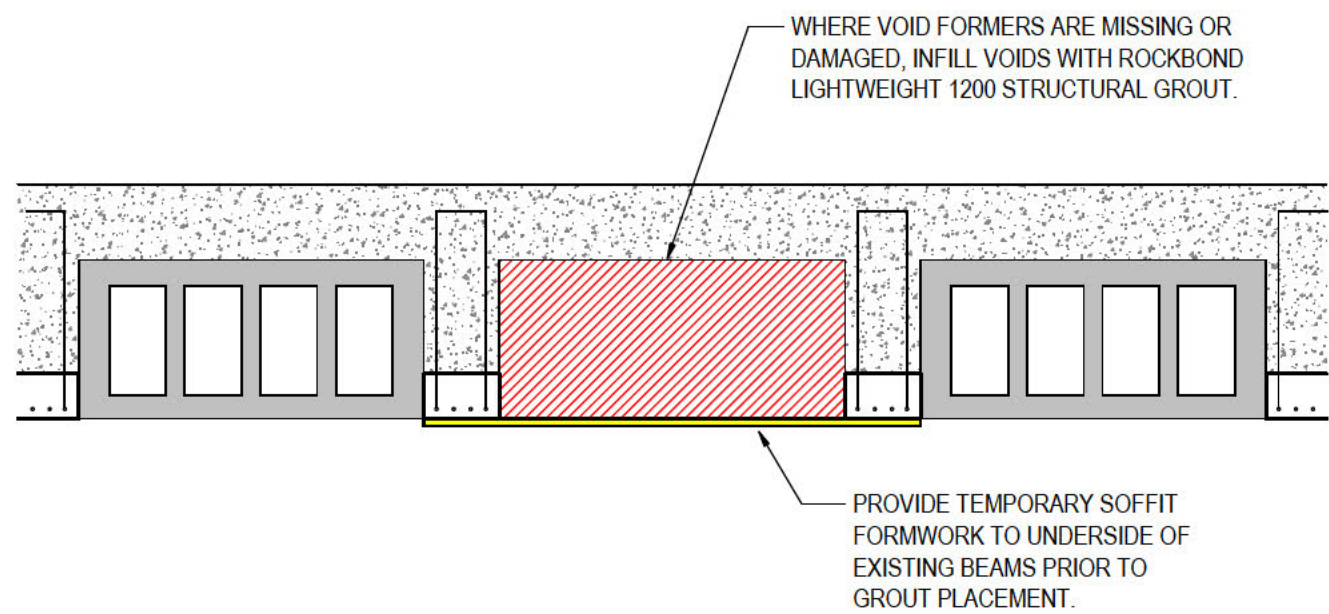

SECTION THROUGH PROPOSED FLOOR REPAIR

2 DETAIL
FLOOR REPAIR DETAIL
SCALE 1:10

REPAIR NOTES

ALL LOOSE, DELAMINATED OR UNSOUND MATERIAL TO BE REMOVED PRIOR TO REPAIR WORKS.

EXISTING CONCRETE SURFACES TO BE CLEANED AND PREPARED IN ACCORDANCE WITH MANUFACTURER'S RECOMMENDATIONS. CONTRACTOR TO VERIFY EXTENT OF MISSING VOID FORMERS ON SITE PRIOR TO COMMENCEMENT OF WORKS.


GROUT TO BE PLACED IN A CONTROLLED MANNER TO ENSURE COMPLETE FILLING OF VOIDS.

ALL REPAIR MATERIALS TO BE INSTALLED IN ACCORDANCE WITH MANUFACTURER'S SPECIFICATION.


TEMPORARY WORKS / SEQUENCING

TEMPORARY WORKS DESIGN TO BE UNDERTAKEN BY CONTRACTOR.
FORMWORK TO REMAIN IN POSITION UNTIL REPAIR MATERIAL HAS ACHIEVED REQUIRED STRENGTH.
DO NOT OVERLOAD EXISTING FLOOR DURING REPAIR WORKS.

TYPICAL 203 UC TO 203 UC CONNECTION
10mm WELDED PLATE TO TOES.
10mm WELDED END PLATE.
10mm WEB STIFFENER
4 No M16 8.8 BOLTS
ALL WELDS TO BE 6mm FW.

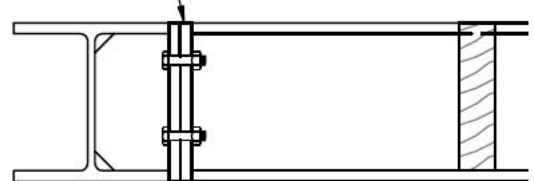


3 SECTION
Section 3
SCALE 1:10

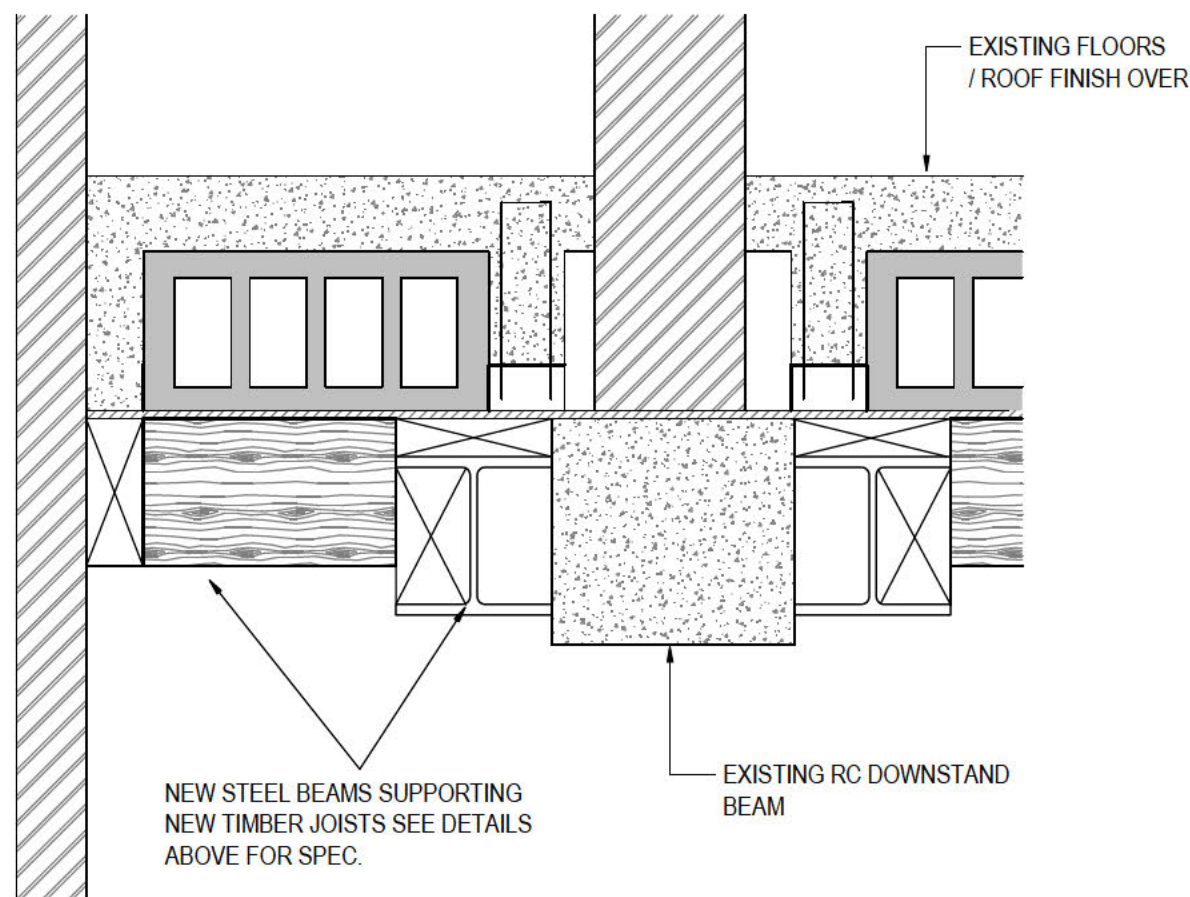


9 SECTION
SECTION 9
SCALE 1:10


4 DETAIL
BEAM BEARING DETAIL - 1
SCALE 1:10

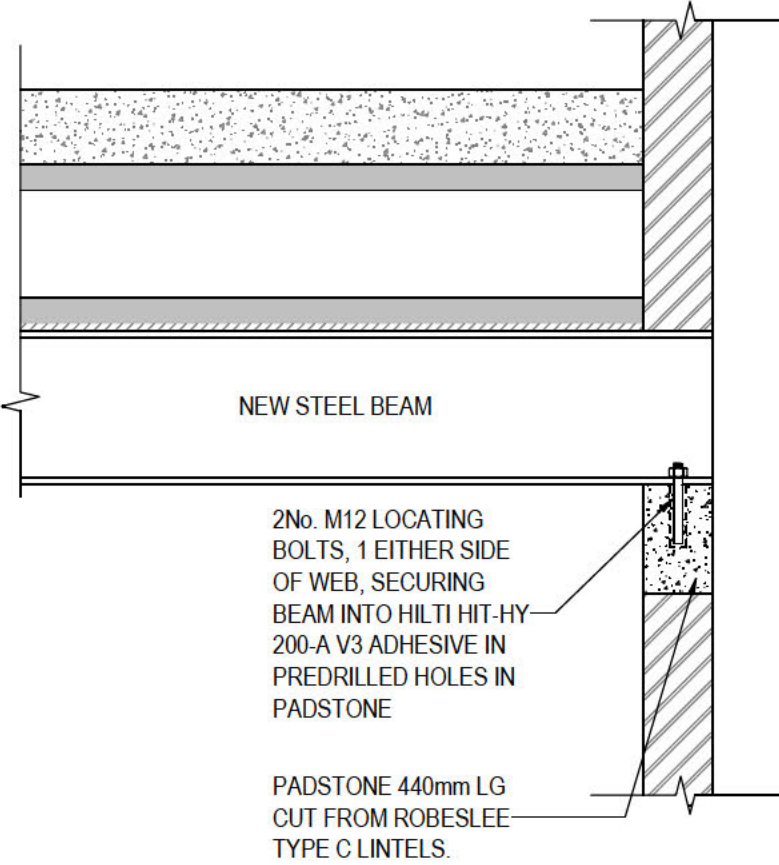

5 DETAIL
BEAM BEARING DETAIL - 2
SCALE 1:10

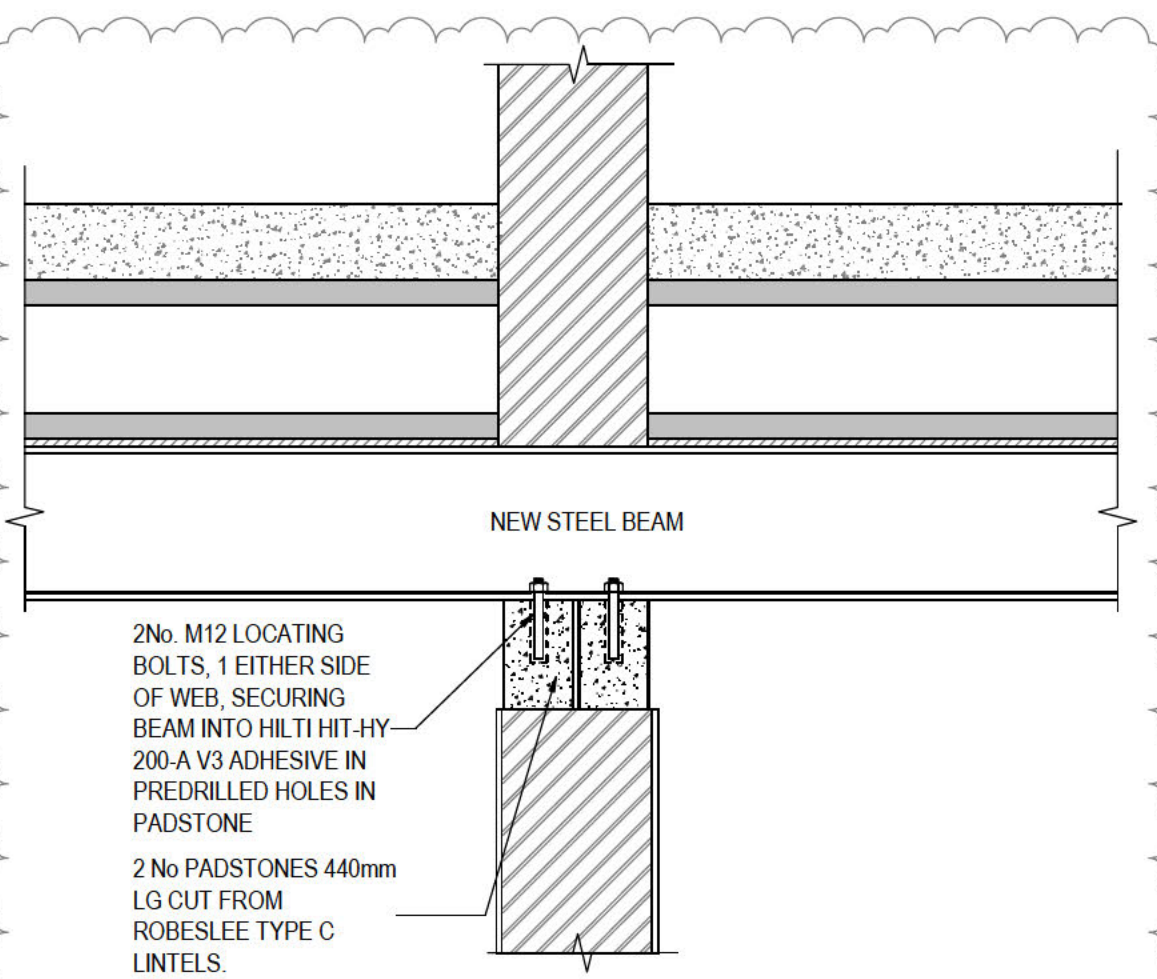


6 DETAIL
TIMBER TO STEEL
SCALE 1:10

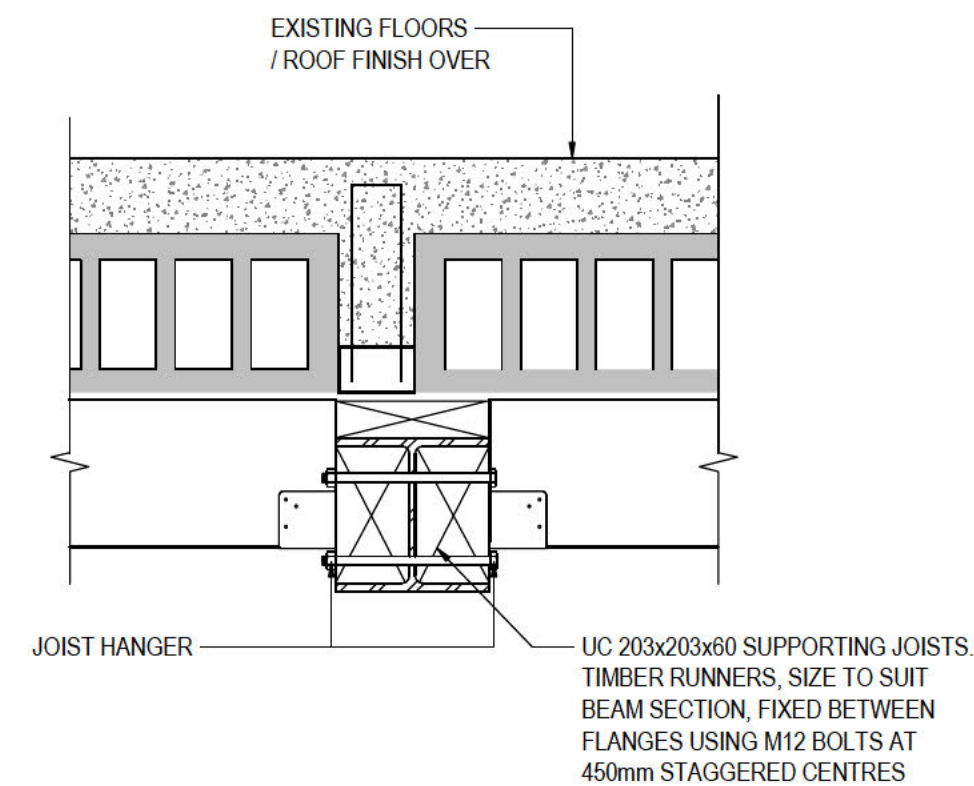


STEEL BEAM SUPPORTING JOISTS IN FLOOR DEPTH


7 DETAIL
BEAM END DETAIL FIXING TO CONCRETE
SCALE 1:10

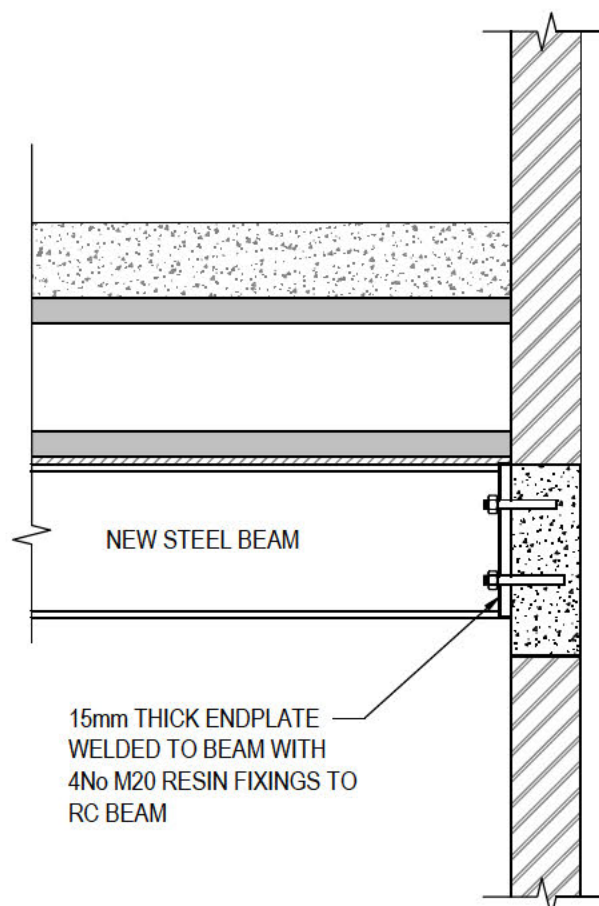


8 SECTION
SECTION 6
SCALE 1:10

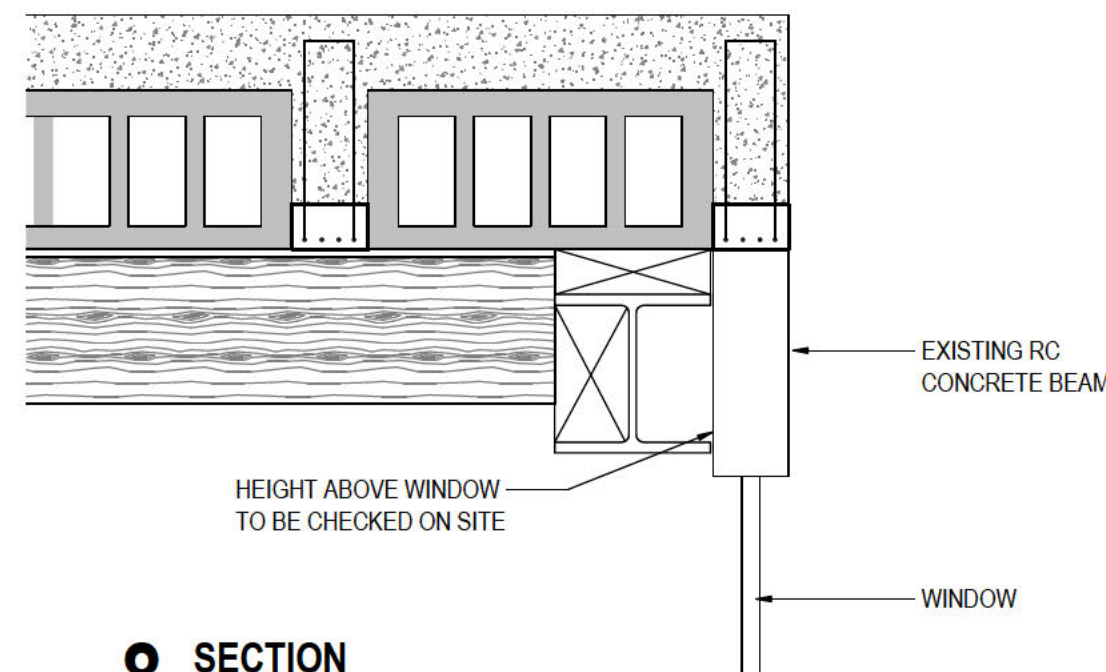

10 DETAIL
TIMBER PACKER TO STEEL BEAM
BOLTING PATTERN
SCALE 1:10

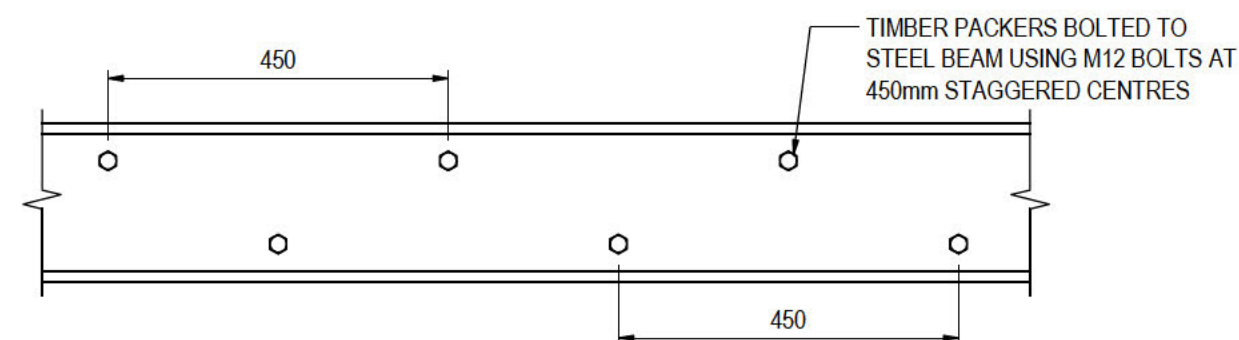

11 DETAIL
203UC SPLICE CONNECTION DETAIL
SCALE 1:5

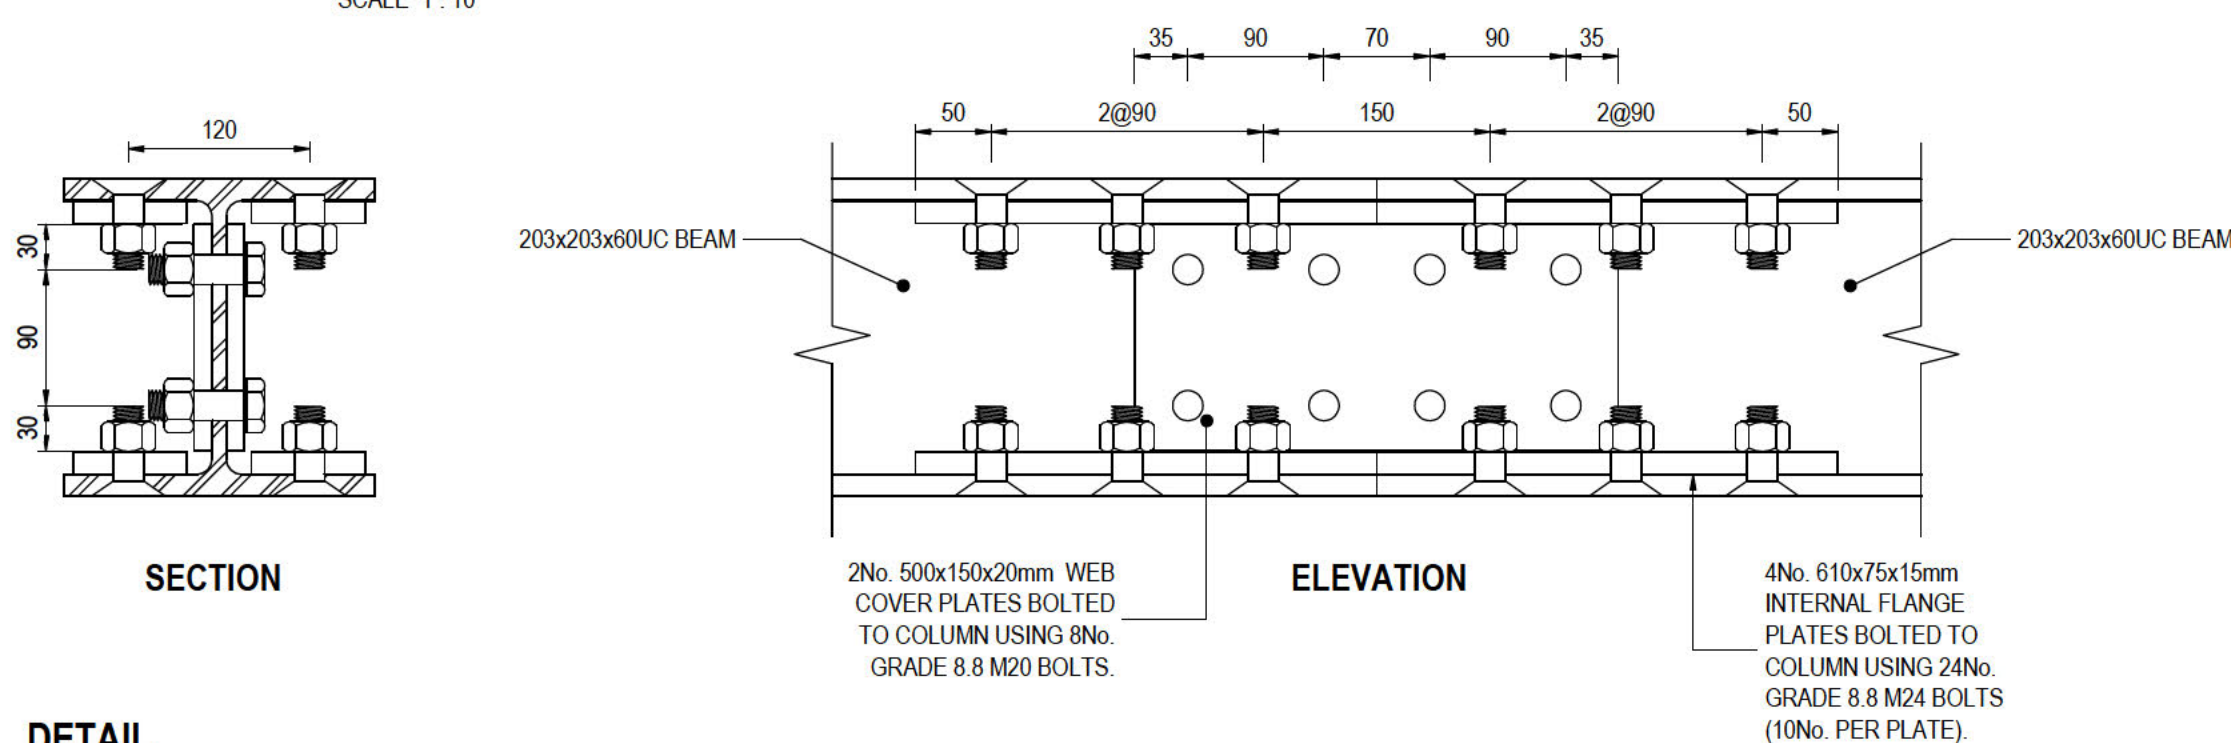

GENERAL NOTES

- DO NOT SCALE FROM THIS DRAWING - IF IN DOUBT CONTACT PROJECT ENGINEER.
- ALL DIMENSIONS ARE IN MILLIMETRES UNLESS STATED OTHERWISE.
- ALL LEVELS ARE IN METRES.
- THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECTURAL, STRUCTURAL AND SERVICES DRAWINGS.
- THE CONTRACTOR IS TO VERIFY ALL DIMENSIONS ON SITE AND IS RESPONSIBLE FOR ACCURATE SETTING OUT.
- ALL SETTING OUT TO BE AS PER THE ARCHITECT'S DRAWINGS.
- THE CONTRACTOR IS TO CONFIRM THE EXISTING BOUNDARY AND SITE STRUCTURES ETC. PRIOR TO COMMENCING THE WORKS AND IMMEDIATELY INFORM THE SUPERVISING OFFICER SHOULD THESE BE AT VARIANCE WITH THE ASSUMPTIONS SHOWN ON THE DRAWING.

CONSTRUCTION (DESIGN AND MANAGEMENT) REGULATIONS 2015

THE DESIGNS ON THIS DRAWING ARE PREPARED WITH CONSIDERATION OF THE NEED TO IDENTIFY HAZARDS AND GIVE REGARD TO THEIR ELIMINATION OR MINIMISATION. REFERENCE MUST BE MADE TO THE HEALTH AND SAFETY INFORMATION PREPARED BY THE PRINCIPAL DESIGNER.

C02	ISSUED FOR CONSTRUCTION	2807/26
C01	ISSUED FOR CONSTRUCTION	2407/26
R01	FIRST ISSUE	01/06/26
ISSUE	DETAILS	DATE

STATUS / PURPOSE OF ISSUE:

CONSTRUCTION

SUITABILITY:

S4

Will Rudd
Will Rudd Davidson (Edinburgh) Ltd
Consulting Civil & Structural Engineers
43 York Place
Edinburgh EH1 3HP
T: 0131 557 5255
E: edinburgh@ruddconsult.com
www.ruddconsult.com

CLIENT:
THE CITY OF EDINBURGH COUNCIL

PROJECT NAME:
St. CUTHBERTS RC PRIMARY SCHOOL

TITLE / DESCRIPTION:
TYPICAL STRUCTURAL DETAILS

WRD REF: E20955.00		SCALE AT A1: 1:10					
PROJECT	ORIG.	VOL.	LEVEL	TYPE	ROLE	No.	REV
E20955.00 - WRD-ZZ-ZZ-DR-S-200003							C02

Will Rudd Davidson (Edinburgh) Ltd Consulting Civil & Structural Engineers 43 York Place, Edinburgh, EH1 3HP T: 0131 557 5255 E: edinburgh@ruddconsult.com
Will Rudd Davidson (Glasgow) Ltd Consulting Civil & Structural Engineers 100 Brunswick St, Glasgow, G1 1TF T: 0141 248 4866 E: glasgow@ruddconsult.com